

# Holly



### Available materials

- Multi-legged sheet metal shell with machine screw, zinc plated

### Features/Advantages

- Light to medium loads under dead or variable conditions in a variety of hollow base materials
- Expanded, the shell is permanently installed and fixtures can be exchanged by removing and replacing the screw
- Drive Holly does not require a pre-drilled hole

### Concerns

- Hollow construction only

### Approvals/Listings

- G.S.A. Spec FF-B-588D, Type III, Class A (Regular)
- G.S.A. Spec FF-B-588D, Type III, Class B (Drive)




### Order Detail

Order Code	Size	Hole Dia.	Grip Range	Ultimate Tensile & Shear Loads in Lbs. Gypsum Wallboard			Box Quantity	Master Quantity	
				Tension	Shear	Min. Wall Thick.			
0120	1/8 XS	5/16"	0-3/16"	—	—	—	100	3,000	
0121	1/8 SR	5/16"	1/8-5/8"	90	165	1/8"	100	1,200	
0122	1/8 LR	5/16"	5/8-1 1/4"	130	205	5/8"	100	800	
0123	1/8 XLR	5/16"	1 1/4-1 3/4"	260	320	1 1/4"	100	800	
0130	3/16 SR	3/8"	1/8-3/4"	135	300	1/8"	100	500	
0131	3/16 LR	3/8"	3/4-1 1/4"	260	485	3/4"	100	500	
0132	3/16 XLR	3/8"	1 1/4 -1 3/4"	300	490	1 1/4"	100	300	
0140	1/4 SR	7/16"	1/8-5/8"	140	300	1/8"	100	500	
0141	1/4 LR	7/16"	5/8-1 1/4"	165	550	5/8"	50	400	
0142	1/4 XLR	7/16"	1 1/4 -1 3/4"	200	575	1 1/4"	50	400	
Drive Holly									
0150	1/8 XSD	DRIVE N/A	1/16-1/4"	—	—	1/16"	100	1,200	
0151	1/8 SD	DRIVE N/A	1/8-1/2"	25	90	1/8"	100	1,200	
0152	1/8 SLD	DRIVE N/A	1/8-3/4"	85	175	1/8"	100	1,200	
Setting Tool									
0110	Holly Setting Tool							1	—

### Installation

- 1 Drill hole through the base material same diameter as fastener. Clean hole of debris.
- 2 Insert the fastener through the material and tap until head is flat against the wall surface.
- 3 Turn screw with screwdriver until fastener is expanded. Can also be set using a Holly Setting Tool.
- 4 Remove screw.
- 5 Place fixture. Replace screw through fixture and tighten.

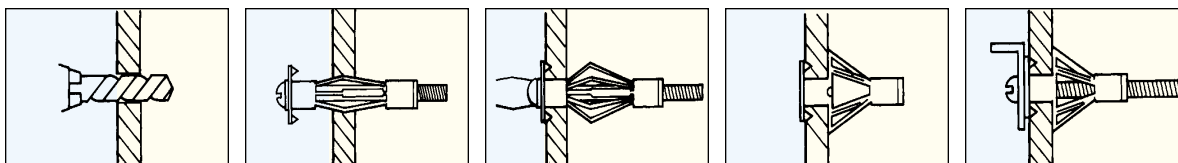

Contact Hurripanel Fasteners for a Quote  
 1.972.417.8882 • [www.hurripanel.com](http://www.hurripanel.com)